



HYUNDAI Technical Service Bulletin

Group	CHASSIS
Number	06-50-005
Date	MARCH, 2006
Model	2006 SONATA

Subject
ALUMINUM WHEEL CAP REPLACEMENT

CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

DESCRIPTION:

The aluminum wheel cap acrylic "H" logo may separate when exposed to elevated temperatures. If this occurs on a vehicle, replace all four wheel caps at the same time.



VEHICLES AFFECTED:

Model: SONATA(NF)

Affected vehicle production date range:
Start of Production through October 1st, 2005

PART REQUIRED:

PART NAME	PART NUMBER	QUANTITY
Wheel cap	52960-3K210	4

SERVICE PROCEDURE:

1. Drill a hole in the wheel cap large enough to insert a screw driver or pick a 1/4" drill bit is recommended.

CAUTION: Use care not to damage wheel or hub under wheel cap.

WARNING: Wear eye protection when operating a drill.

2. Insert a screwdriver or pick into the hole and carefully pry the wheel cap from the wheel.

CAUTION: Use care not to scratch the wheel during cap removal.

WARNING: Acrylic cap could shatter during removal.



3. Push the new wheel cap into the wheel center until fully seated.
4. Replace the remaining wheel caps.

OPERATION CODE AND TIME:

OP CODE	OPERATION	OP TIME	CAUSAL P/N	NATURE CODE	CAUSE CODE
52960F00	Replacement of wheel caps (4 each)	0.3	52960-3K210	*N86	**C63

*N86 : Falling off, sagged

**C63 : Flaw in material