



# HYUNDAI Technical Service Bulletin

Group	STEERING SYSTEM
Number	08-ST-001
Date	AUGUST, 2008
Model	ALL

Subject	<b>SERVICE TIP - POWER STEERING OIL PUMP WHINE NOISE</b>
---------	--


<b>CIRCULATE TO:</b>	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

**DESCRIPTION:**

Before replacing a power steering oil pump for a "whine" noise condition, check the oil pump reservoir filter screen for contamination. If the filter screen at the bottom of the oil pump reservoir is clogged, it may cause the pump to aerate and cause a "whine" noise.

If the filter screen is clogged, replace the reservoir and reconfirm the condition.

The photo below shows the location of the screen in the reservoir.

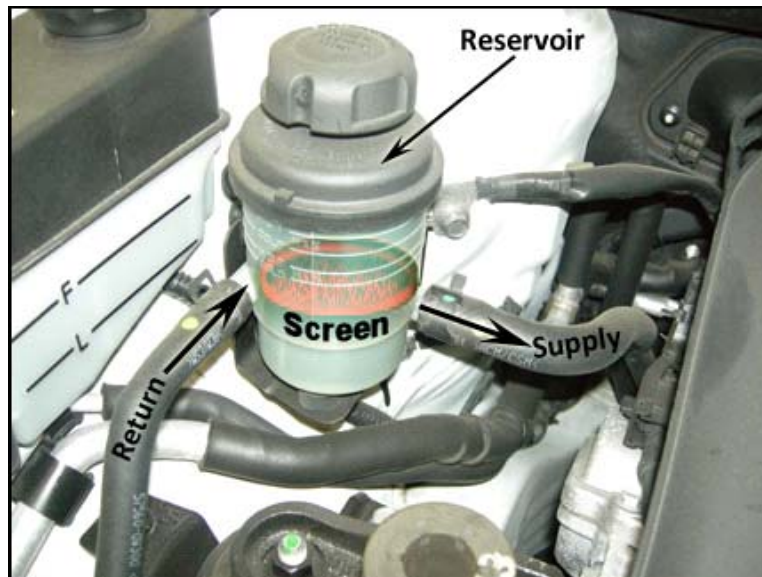

**NOTE:** For proper inspection of the screen, it may be necessary to empty the power steering oil pump reservoir.