



HYUNDAI Technical Service Bulletin

Group	AUTOMATIC TRANSMISSION
Number	08-AT-002
Date	APRIL, 2008
Model	2006~ SONATA, 2006~ AZERA, 2007~ SANTA FE, 2007~ VERACRUZ, 2009~ GENESIS

Subject
**AUTOMATIC TRANSMISSION SHIFT KNOB
REPLACEMENT PROCEDURE**

CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY MGR	<input type="checkbox"/> SALES MANAGER

DESCRIPTION:

This bulletin provides a procedure to remove and replace the automatic transmission shift knob.

AFFECTED VEHICLES: 2006~ SONATA, 2006~ AZERA, 2007~ SANTA FE, 2007~ VERACRUZ and 2009~ GENESIS:

SERVICE PROCEDURE:

2006~ Azera, 2007~ Santa Fe, 2007~ Veracruz and 2009~ Genesis:


1. Engage the parking brake and put the transmission in neutral.
2. Pull up on the shift knob to disengage the snap ring (A) and remove the shift knob.

NOTE: An upward force of 50 lbs may be required to remove the knob.




3. Push down on the shift knob to install.

NOTE: It is not necessary to remove the decorative plastic cover (B) to access the snap ring (A). Removing this cover may damage to the shift lever.

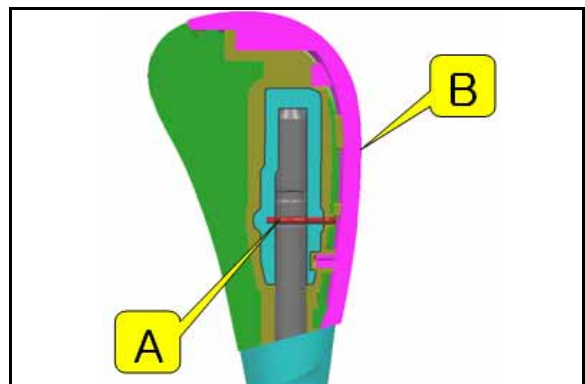

2006~ Sonata:

1. Rotate the shift knob counter-clockwise to remove the knob.
2. Rotate the shift knob clockwise to install.

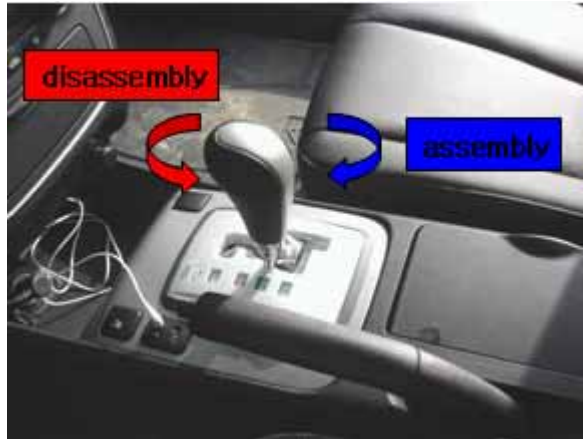

OTHER MODELS:

Refer to appropriate shop manual, Automatic Transaxle section, "Automatic Transaxle Control System" for information.

WARRANTY INFORMATION:

OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
43712R00	Gear shift lever knob	0.2	See parts catalog	N86	C06